


PLYWOOD

QUALITY STANDARD

FACE

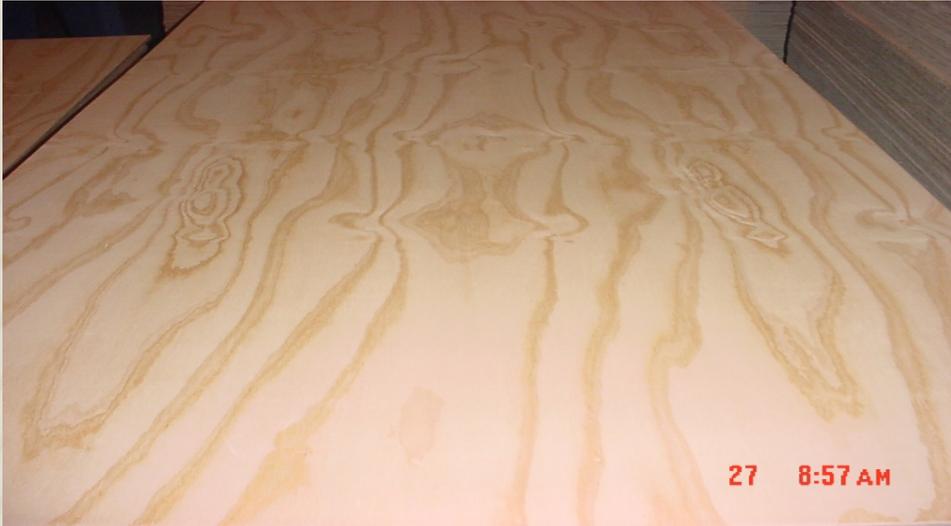

BACK



- Surface: Soft, Well Sanded
- Knots: Not Accept
- Blue Stain: Not Accept
- Open Cracks: Not Accept
- Patches: Accept, Max 6 patches
- Repair: Accept, Putty repair
Max length 300mm/Width 1mm
- Resin Bags: Not Accept

- Surface: Rough Surface Accept
Touch Sanded
- Sound Knots: Accept, Max. Width 40mm
- Dead Knots: Accept, Max. Width 50mm
- Blue Stain: Accept
- Cracks: Accept, Max. Width 65mm
Without Limit

FACE



- Surface: Soft, Well Sanded
- Knots: Accept, Max. Width 25mm
- Blue Stain: Accept, Light blue stain
- Open Cracks: Not Accept
- Patches: Accept, Max 6 patches
- Repair: Accept, Putty repair
Max length 300mm/Width 2mm
- Resin Bags: Accept

BACK



- Surface: Rough Surface Accept
Touch Sanded
- Sound Knots: Accept, Max. Width 40mm
- Dead Knots: Accept, Max. Width 50mm
- Blue Stain: Accept
- Cracks: Accept, Max. Width 65mm
Without Limit

Quality CpC (CD Plugged)

FACE



- Surface: Soft, Well Sanded
- Sound Knots: Accept, Max. Width 40mm
- Dead Knots: Accept, Max. Width 40mm
- Blue Stain: Accept
- Cracks: Accept
- Patches: Accept, Max 10 patches
- Repair: Well Repaired

BACK



- Surface: Rough Surface Accept
Touch Sanded
- Sound Knots: Accept, Max. Width 40mm
- Dead Knots: Accept, Max. Width 50mm
- Blue Stain: Accept
- Cracks: Accept, Max. Width 65mm
Without Limit

FACE



- Surface: Rough Surface Accept
Unsanded
- Sound Knots: Accept, Max. Width 40mm
- Dead Knots: Accept, Max. Width 40mm
- Blue Stain: Accept
- Cracks: Accept

BACK



- Surface: Rough Surface Accept
Unsanded
- Sound Knots: Accept, Max. Width 65mm
- Dead Knots: Accept, Max. Width 65mm
- Blue Stain: Accept
- Cracks: Accept, Max. Width 65mm
Without Limit

Quality BCFD (Shop Grade)



Declassification from AC and BC

Accept

- Dry Out in edges: max. 5 x 10 cm
- Lack of material in the edge: max. 5x10 cm
- Bad Repair
- Lack of Sanding: only in 5% of the Surface
Light Over-Sanding
- Problems in the Back: Lack of material

Not Accept

- Blown.



Declassification from all Qualities

Accept

- Blown.
- Dry Out
- Lack of material in the Edge
- Bad Repair
- Over-sanding
- Problems in the Back: Lack of material